

METTLER TOLEDO





This User Manual provides brief instructions about the first steps to take with the instrument. This ensures safe and efficient handling. Personnel must have carefully read and understood this manual before performing any task.



For full information, always refer to the Reference Manual (RM).

► www.mt.com/XPR-precision-RM

Overview balances with S weighing platform

0.1 mg


5 mg / 10 mg

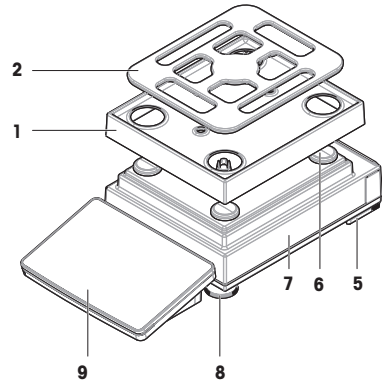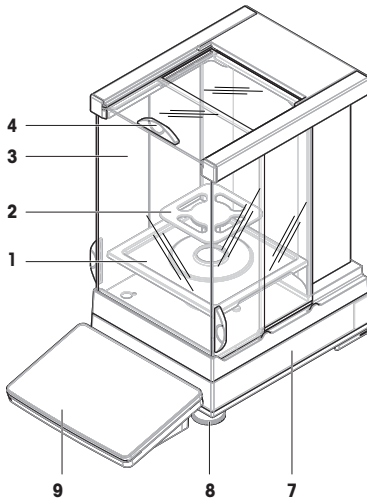

1	DripTray	6	Weighing pan support cap
2	SmartPan Pro weighing pan	7	Weighing platform with protective cover
3	Pro draft shield	8	Leveling foot
4	Pro draft shield door handle	9	Terminal with protective cover
5	Safety foot		


Overview comparators with S weighing platform

0.1 mg / 1 mg

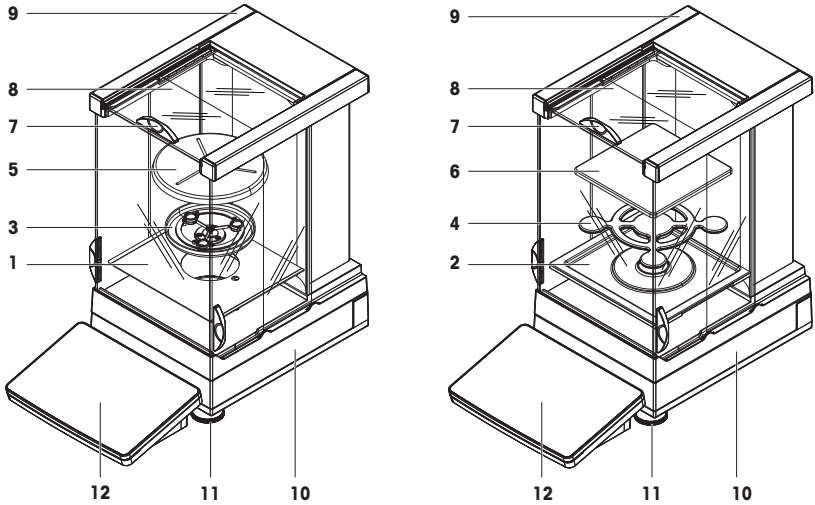

1	Bottom plate	7	Pro draft shield door handle
2	Drip tray	8	Pro draft shield door
3	LevelMatic weighing pan holder	9	Pro draft shield
4	SmartPan weighing pan	10	Weighing platform with protective cover
5	LevelMatic weighing pan	11	Leveling foot
6	Weighing pan	12	Terminal with protective cover


Overview interface board S weighing platform

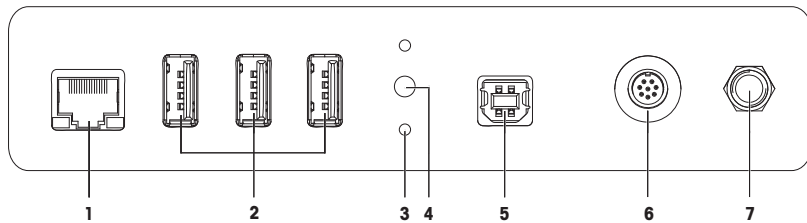


1	Ethernet port	5	USB-B port (to host)
2	USB-A ports (to device)	6	Socket for terminal cable
3	Fixations for optional terminal stand	7	Socket for AC/DC adapter
4	Service seal		

Overview balances with L weighing platform

10 mg

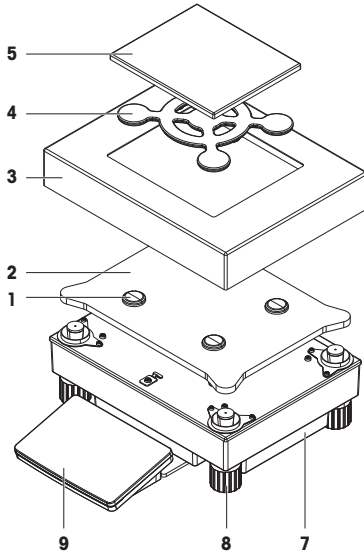


100 mg / 1 g

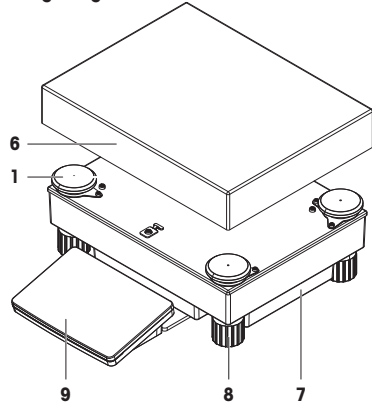

1	Weighing pan support cap	6	Weighing pan
2	Adapter plate	7	Weighing platform
3	Draft shield element	8	Leveling foot
4	SmartPan weighing pan	9	Terminal with protective cover
5	Weighing pan with protective cover		


Overview comparators with L weighing platform

1 mg / 5 mg / 10 mg

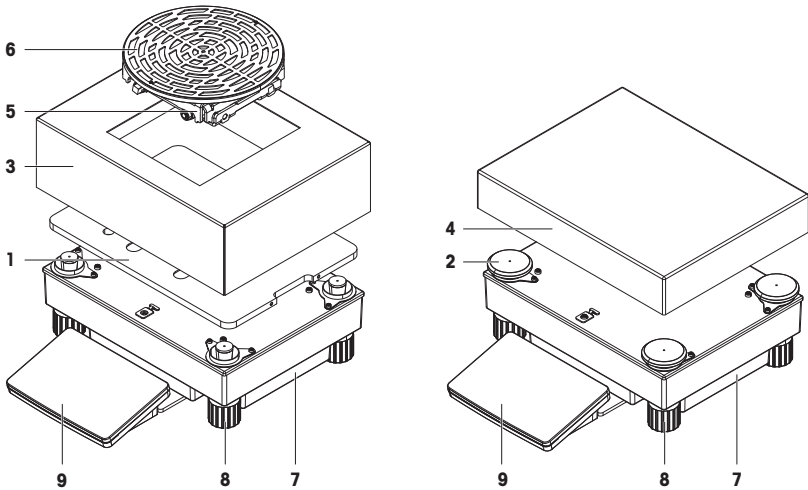


1	Adapter plate with LevelMatic base plate	6	LevelMatic weighing pan
2	Weighing pan support cap	7	Weighing platform
3	Draft shield element	8	Leveling foot
4	Weighing pan	9	Terminal with protective cover
5	LevelMatic weighing pan holder		

Overview interface board L weighing platform

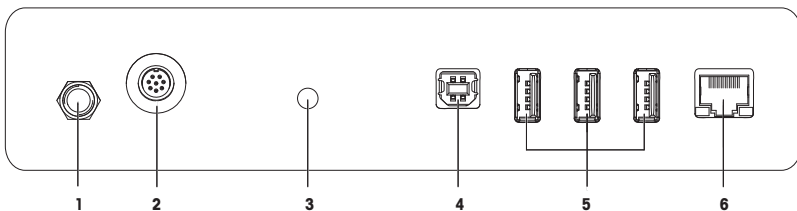

1	Socket for AC/DC adapter	4	USB-B port (to host)
2	Socket for terminal cable	5	USB-A ports (to device)
3	Service seal	6	Ethernet port

Overview terminal

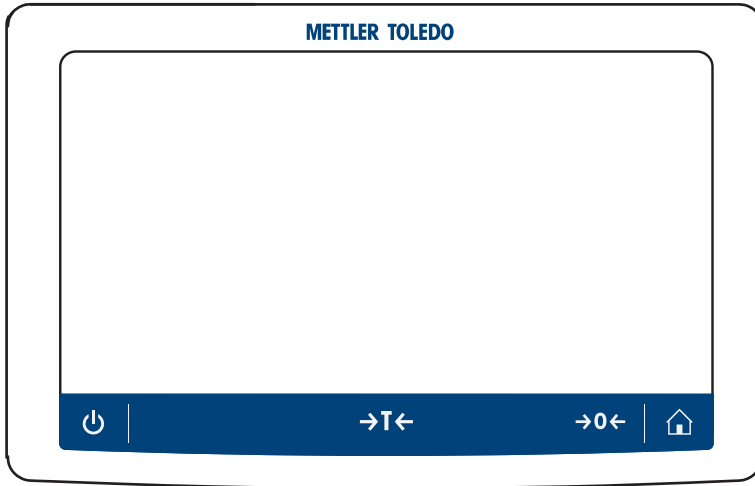





	Standby		Tare
	Home screen		Zero

Table of Contents

1	Introduction	3
1.1	Further documents and information	3
1.2	Acronyms and abbreviations	3
1.3	Compliance information	4
2	Safety Information	4
2.1	Definitions of signal words and warning symbols	4
2.2	Product-specific safety information	4
3	Design and Function	5
3.1	Overview	5
3.2	User interface	6
3.2.1	Main sections at a glance	6
3.2.2	Main weighing screen	6
4	Installation and Putting into Operation	7
4.1	Selecting the location	7
4.2	Unpacking the balance	8
4.3	Scope of delivery	9
4.3.1	Balances with S weighing platform	9
4.3.2	Comparators with S weighing platform	10
4.3.3	Balances with L weighing platform	10
4.3.4	Comparators with L weighing platform	11
4.4	Installation	11
4.4.1	Balances and comparators with S weighing platform	11
4.4.1.1	Attaching the terminal to the weighing platform	11
4.4.1.2	Assembling the Pro draft shield for 0.1 mg balances and comparators	12
4.4.1.3	Assembling the Pro draft shield on the weighing platform	13
4.4.1.4	Assembling balances 0.1 mg with SmartPan Pro weighing pan	13
4.4.1.5	Assembling balances 1 mg with Pro draft shield	14
4.4.1.6	Assembling balances 1 mg with SmartPan Pro weighing pan	14
4.4.1.7	Assembling balances 5 mg and 10 mg with SmartPan weighing pan	14
4.4.1.8	Assembling balances 100 mg	15
4.4.1.9	Assembling comparators 0.1 mg and 1 mg with LevelMatic weighing pan	15
4.4.2	Balances and comparators with L weighing platform	16
4.4.2.1	Attaching the terminal to the weighing platform	16
4.4.2.2	Assembling balances 100 mg and 1 g	16
4.4.2.3	Assembling balances 10 mg with SmartPan weighing pan	17
4.4.2.4	Removing and installing the transport safety screws (only for comparators)	17
4.4.2.5	Assembling comparators 1 mg / 5 mg with LevelMatic weighing pan	18
4.4.2.6	Assembling the comparator XPR64002LC-T	18
4.5	Putting into operation	18
4.5.1	Connecting the balance	18
4.5.2	Switching on the balance	19
4.5.3	Leveling the balance	19
4.5.4	Performing an internal adjustment	19
4.5.5	Entering / Exiting standby mode	20
4.5.6	Switching off the balance	20

4.6	Performing a simple weighing	20
4.6.1	Zeroing the balance	20
4.6.2	Taring the balance	20
4.6.3	Performing a weighing	20
4.6.4	Completing the weighing	20
4.7	Transporting, packing and storing	21
4.7.1	Transporting the balance over short distances	21
4.7.2	Transporting the balance over long distances	21
4.7.3	Packing and storing	22
5	Maintenance	22
5.1	Maintenance tasks	22
5.2	Cleaning	23
5.2.1	Disassembling the Pro draft shield for cleaning	23
5.2.2	Cleaning the balance	23
5.2.3	Putting into operation after cleaning	24
6	Technical Data	24
6.1	General data	24
7	Disposal	25

1 Introduction

Thank you for choosing a METTLER TOLEDO balance. The balance combines high performance with ease of use.

Disclaimer for comparators

In this document, the term "balance" is used to describe both balances and comparators.

Comparators are characterized by their higher resolution compared to balances. They are mainly used for differential weighing applications, such as the calibration of standard weights. Beside standard balance tests, comparators have also been tested with differential repeatability (ABA repeatability) during production.

EULA

The software in this product is licensed under the METTLER TOLEDO End User License Agreement (EULA) for Software.

When using this product you agree to the terms of the EULA.

▶ www.mt.com/EULA

1.1 Further documents and information

This document is available in other languages online.

Product page:

▶ www.mt.com/XPR-precision

Instructions for cleaning a balance, "8 Steps to a Clean Balance":

▶ www.mt.com/lab-cleaning-guide

Search for software:

▶ www.mt.com/labweighing-software-download

Search for documents:

▶ www.mt.com/library

For further questions, please contact your authorized METTLER TOLEDO dealer or service representative.

▶ www.mt.com/contact

1.2 Acronyms and abbreviations

Original term	Explanation
AC	Alternating Current
ASTM	American Society for Testing and Materials
DC	Direct Current
EMC	Electromagnetic Compatibility
FCC	Federal Communications Commission
GWP	Good Weighing Practice
HID	Human Interaction Device
ID	Identification
LED	Light-Emitting Diode
LPS	Limited Power Source
MAC	Media Access Control
MT-SICS	METTLER TOLEDO Standard Interface Command Set
NA	Not Applicable
OIML	Organisation Internationale de Métrologie Légale (International Organization of Legal Metrology)
RAM	Random Access Memory
RFID	Radio-frequency identification
RM	Reference Manual

SELV	Safety Extra Low Voltage
SOP	Standard Operating Procedure
SQC	Statistical Quality Control
UM	User Manual
USB	Universal Serial Bus
USP	United States Pharmacopeia

1.3 Compliance information

National approval documents, e.g., the FCC Supplier Declaration of Conformity, are available online and/or included in the packaging.

► www.mt.com/ComplianceSearch



For further information, consult the Reference Manual (RM).

► www.mt.com/XPR-precision-RM

2 Safety Information

Two documents named "User Manual" and "Reference Manual" are available for this instrument.

- The User Manual is printed and delivered with the instrument.
- The electronic Reference Manual contains a full description of the instrument and its use.
- Keep both documents for future reference.
- Include both documents if you transfer the instrument to other parties.

Only use the instrument according to the User Manual and the Reference Manual. If you do not use the instrument according to these documents or if the instrument is modified, the safety of the instrument may be impaired and Mettler-Toledo GmbH assumes no liability.

2.1 Definitions of signal words and warning symbols

Safety notes contain important information on safety issues. Ignoring the safety notes may lead to personal injury, damage to the instrument, malfunctions and false results. Safety notes are marked with the following signal words and warning symbols:

Signal words

DANGER	A hazardous situation with high risk, resulting in death or severe injury if not avoided.
WARNING	A hazardous situation with medium risk, possibly resulting in death or severe injury if not avoided.
CAUTION	A hazardous situation with low risk, resulting in minor or moderate injury if not avoided.
NOTICE	A hazardous situation with low risk, resulting in damage to the instrument, other material damage, malfunctions and erroneous results, or loss of data.

Warning symbols



General hazard



Notice

2.2 Product-specific safety information

Intended use

This instrument is designed to be used by trained staff. The instrument is intended for weighing purposes.

Any other type of use and operation beyond the limits of use stated by Mettler-Toledo GmbH without consent from Mettler-Toledo GmbH is considered as not intended.

Responsibilities of the instrument owner

The instrument owner is the person holding the legal title to the instrument and who uses the instrument or authorizes any person to use it, or the person who is deemed by law to be the operator of the instrument. The instrument owner is responsible for the safety of all users of the instrument and third parties.

Mettler-Toledo GmbH assumes that the instrument owner trains users to safely use the instrument in their workplace and deal with potential hazards. Mettler-Toledo GmbH assumes that the instrument owner provides the necessary protective gear.

Safety notes



WARNING

Death or serious injury due to electric shock

Contact with parts that carry a live current can lead to death or injury.

- 1 Only use the METTLER TOLEDO power cable and AC/DC adapter designed for your instrument.
- 2 Connect the power cable to a grounded power outlet.
- 3 Keep all electrical cables and connections away from liquids and moisture.
- 4 Check the cables and the power plug for damage and replace them if damaged.



NOTICE

Damage to the instrument or malfunction due to the use of unsuitable parts

- Only use parts from METTLER TOLEDO that are intended to be used with your instrument.

A list of spare parts and accessories can be found in the Reference Manual.

3 Design and Function



For further information, consult the Reference Manual (RM).

► www.mt.com/XPR-precision-RM

3.1 Overview

See the sections "Overview" (graphics and legend) at the very beginning of this manual.

3.2 User interface

3.2.1 Main sections at a glance

The main weighing screen (1) is the central navigation point where all the menus and settings can be found. The **Balance menu** (2), **Methods** (3) and **Results** (4) open when tapping the tabs along the sides of the main weighing screen.



See also

🔗 Main weighing screen ▶ Page 6

3.2.2 Main weighing screen



	Name	Description
1	User name	Shows the name of the current user.
2	Weighing value field	Shows the current weighing value.

	Name	Description
3	Level indicator	Indicates if the balance is leveled (green) or not (red).
4	Methods menu	Accesses the user-defined list of methods, tests, and alignments.
5	Info weight	Shows the current weighing value in another unit.
6	Warning and error message area	Shows current warning and/or error messages.
7	Results list	Shows the weighing results saved for this task.
8	Sample status OK	Result status indicator green: indicates that the result fulfills a set of criteria. For example: <ul style="list-style-type: none"> • The balance is in level. • The internal adjustment was performed and ok. • The weighing result is within the defined tolerance range (only if tolerance is defined).
9	Sample status Excluded	Result status indicator black: indicates that the result was excluded from the Results list .
10	Sample status Not OK	Result status indicator red: indicates that the result criteria are not fulfilled, e.g., "The weighing result was out of the defined tolerances".
11	Button Add result	Adds the result to the Results list . Depending on the selected method, the button can have different functions.
12	Action bar	Contains actions referring to the current task.
13	Balance menu	Accesses the balance properties.
14	Method information area	Contains information about the sample, method or task IDs.
15	SmartTrac	Used as a weighing aid to define a target weight with upper and lower tolerances.
16	Weighing value area	Shows the results of the current weighing process.
17	Method name	Shows the name of the current method.

4 Installation and Putting into Operation

4.1 Selecting the location

A balance is a sensitive precision instrument. The location where it is placed will have a profound effect on the accuracy of the weighing results.



Requirements of the location

Place indoors on stable table


Ensure sufficient spacing

Level the instrument

Provide adequate lighting

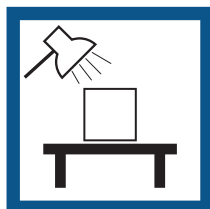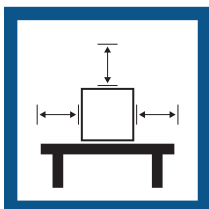

Avoid direct sunlight

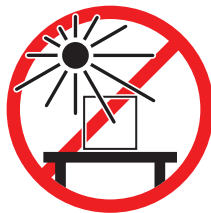

Avoid vibrations



Avoid strong drafts



Avoid temperature fluctuations



Sufficient spacing for balances: > 15 cm all around the instrument

Take into account the environmental conditions. See "Technical Data".

4.2 Unpacking the balance

Open the balance packaging and check for transportation damage or missing parts. Please inform a METTLER TOLEDO service representative in the event of missing or defective parts.

METTLER TOLEDO recommends retaining the original box with its packaging elements. Use the packaging elements to store and to transport the balance.

4.3 Scope of delivery

4.3.1 Balances with S weighing platform

Components	0.1 mg with Pro draft shield	0.5 mg / 1 mg with Pro draft shield	1 mg without Pro draft shield	5 mg / 10 mg	100 mg
Weighing platform with protective cover	✓	✓	✓	✓	✓
Terminal with protective cover	✓	✓	✓	✓	✓
Terminal holder	✓	✓	✓	✓	✓
Terminal cable (pre-assembled)	✓	✓	✓	✓	✓
Pro draft shield	✓	✓	–	–	–
Weighing pan 128 × 128 mm	–	✓ ¹	–	–	–
Weighing pan 172 × 205 mm	–	–	–	✓ ¹	–
Weighing pan 193 × 223 mm	–	–	–	–	✓
SmartPan Pro / SmartPan weighing pan 90 × 90 mm	✓ ²	–	–	–	–
SmartPan Pro / SmartPan weighing pan 127 × 127 mm	–	✓ ¹	✓ ²	–	–
SmartPan Pro / SmartPan weighing pan 170 × 203 mm	–	–	–	✓ ¹	–
Weighing pan support	–	–	–	–	✓
Drip tray	✓	✓	✓	✓	–
Seal for Pro draft shield	✓	–	–	–	–
Weighing hook for below-the-balance weighing	✓	✓	✓	✓	✓
AC/DC adapter	✓	✓	✓	✓	✓
Power cable (country-specific)	✓	✓	✓	✓	✓
User Manual	✓	✓	✓	✓	✓
Production certificate	✓	✓	✓	✓	✓
Declaration of Conformity	✓	✓	✓	✓	✓

1) Depending on the status of the approval in your country, your product is delivered either with a SmartPan and a flat weighing pan or with a SmartPan Pro.

2) Depending on the status of the approval in your country, your product is delivered either with a SmartPan or with a SmartPan Pro.

4.3.2 Comparators with S weighing platform

Components	0.1 mg	1 mg
Weighing platform with protective cover	✓	✓
Terminal with protective cover	✓	✓
Terminal cable (pre-assembled)	✓	✓
Pro draft shield (not for XPR10003SC)	✓	✓
Draft shield XP W12 (only for XPR10003SC)	–	✓
SmartPan weighing pan 90 × 90 mm	✓	–
SmartPan weighing pan 127 × 127 mm	–	✓
LevelMatic weighing pan ø 130 mm (not for XPR2003SC)	✓	✓
Bottom plate	✓	✓
Seal for Pro draft shield	✓	–
Weighing hook for below-the-balance weighing	✓	✓
AC/DC adapter	✓	✓
Power cable (country-specific)	✓	✓
User Manual	✓	✓
Mass calibration software MC Link	✓	✓
Production certificate	✓	✓
Declaration of Conformity	✓	✓

4.3.3 Balances with L weighing platform

Components	10 mg	100 mg / 1 g
Weighing platform	✓	✓
Terminal with protective cover	✓	✓
Terminal holder	✓	✓
Terminal cable	✓	✓
Draft shield element	✓	–
Weighing pan 172 × 205 mm	✓	–
Weighing pan 280 × 360 mm	–	✓
SmartPan weighing pan 170 × 203 mm	✓	–
AC/DC adapter	✓	✓
Power cable (country-specific)	✓	✓
User Manual	✓	✓
Production certificate	✓	✓
Declaration of Conformity	✓	✓

4.3.4 Comparators with L weighing platform

Components	1 mg	5 mg	10 mg
Weighing platform	✓	✓	✓
Terminal with protective cover	✓	✓	✓
Terminal holder (not for XPR64002LC-T)	✓	✓	✓
Terminal cable	✓	✓	✓
Draft shield element XP W64 (only for XPR26003LC and XPR64003LD5C)	✓	✓	–
Weighing pan 280 × 360 mm (not for XPR64003LD5C and XPR64002LC)	–	✓	✓
LevelMatic weighing pan ø 220 mm with draft shield element and weighing pan holder (not for XPR32003LD5C)	✓	✓	–
Fixed weighing pan ø 220 mm (only for XPR64002LC-T)	–	–	✓
AC/DC adapter	✓	✓	✓
Power cable (country-specific)	✓	✓	✓
Transport case (only for XPR64002LC-T)	–	–	✓
User Manual	✓	✓	✓
Mass calibration software MC Link	✓	✓	✓
Production certificate	✓	✓	✓
Declaration of Conformity	✓	✓	✓

4.4 Installation

4.4.1 Balances and comparators with S weighing platform

4.4.1.1 Attaching the terminal to the weighing platform

The terminal is usually placed in front of the weighing platform on the terminal holder. Alternatively, the terminal can be placed next to the weighing platform, or attached to an additional terminal stand.

 **Note**

Comparators with S weighing platform are used without a terminal holder.




NOTICE

Damage to the balance


The weighing platform and the terminal are not safely fixed by the terminal holder and may fall off when carrying.

- Remove the terminal from the weighing platform and place it on the weighing pan when carrying the balance.

- 1 Place the weighing platform on a flat surface.
- 2 Place the protection cover (1) on the weighing platform.
- 3 Position the terminal holder (2) in front of the weighing platform. The plug of the pre-mounted terminal cable (3) must lie between the terminal holder (2) and the weighing platform.
- 4 Push the terminal holder (2) towards the weighing platform until the terminal holder locks under the weighing platform.
- 5 Connect the terminal cable to the terminal.

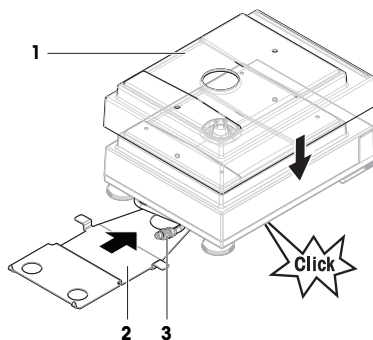


- 6 Place the protection cover (4) on the terminal (5).
- 7 Place the terminal on top of the terminal holder.
- 8 Push the terminal towards the weighing platform until the terminal locks into the terminal holder.

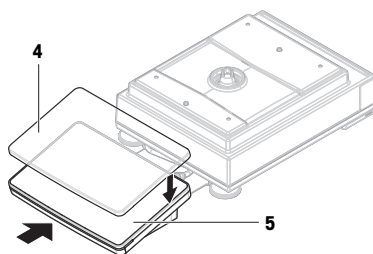


4.4.1.2 Assembling the Pro draft shield for 0.1 mg balances and comparators

- 1 Turn the Pro draft shield carefully sideways into horizontal position.
- 2 Push the seal (2) through the opening (1) on the bottom of the Pro draft shield.

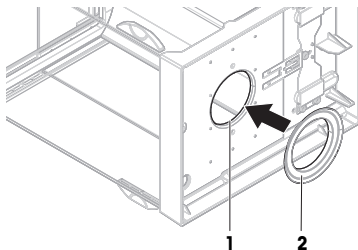


- 3 Fix the seal in the opening of the Pro draft shield. The seal (2) must be properly fixed into the opening. The upper edge (3) of the seal must lay all around the bottom of the Pro draft shield.
- 4 Turn the Pro draft shield carefully back into vertical position.

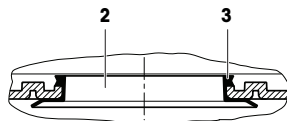

4.4.1.3 Assembling the Pro draft shield on the weighing platform

- 1 Open the Pro draft shield with the door handles on both sides.
- 2 Hold the Pro draft shield on the top bars (1) on both sides and place it on top of the weighing platform.

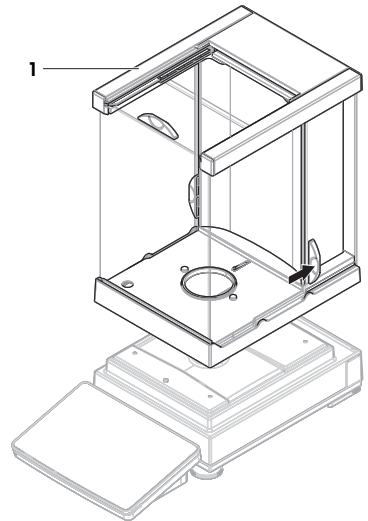


4.4.1.4 Assembling balances 0.1 mg with SmartPan Pro weighing pan

Note

The 0.1 mg balances with Pro draft shield are equipped with a seal. The aim of the seal is to isolate the weighing chamber from draft. The seal must always be correctly installed at the bottom of the Pro draft shield, as described in [Assembling the Pro draft shield for 0.1 mg balances and comparators ▶ Page 12].


- The seal is installed on the Pro draft shield.
- The Pro draft shield is installed on the weighing platform.

- 1 Place the drip tray (1) into the Pro draft shield.
- 2 Place the SmartPan Pro weighing pan (2) on top of the drip tray (1).

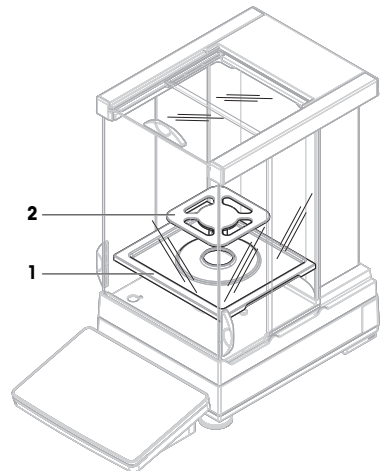


4.4.1.5 Assembling balances 1 mg with Pro draft shield

- The Pro draft shield is installed on the weighing platform.
- 1 Place the drip tray (1) into the Pro draft shield.
 - 2 Place the SmartPan Pro weighing pan (2) on top of the drip tray (1).

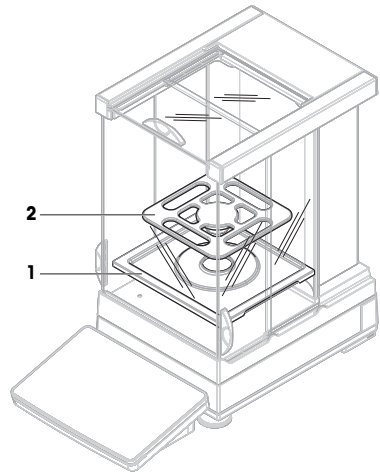


4.4.1.6 Assembling balances 1 mg with SmartPan Pro weighing pan

- 1 Place the drip tray (1) on top of the weighing platform.
- 2 Place the SmartPan Pro weighing pan (2) on top of the drip tray (1).

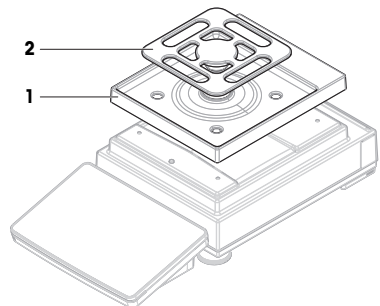


4.4.1.7 Assembling balances 5 mg and 10 mg with SmartPan weighing pan

- 1 Place the four weighing pan support caps (1) on top of the weighing platform.
- 2 Place the drip tray (2) on top of the weighing platform.
- 3 Place the SmartPan Pro weighing pan (3) on top of the weighing pan support caps (1).

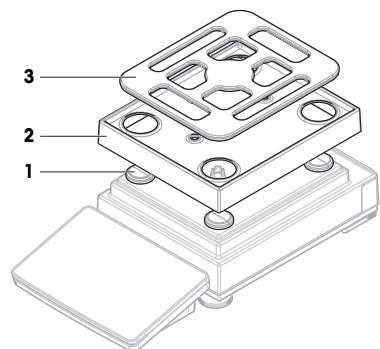

4.4.1.8 Assembling balances 100 mg

- 1 Place the four weighing pan support caps (1) on top of the weighing platform.
- 2 Place the weighing pan support (2) on top of the weighing pan support caps (1).
- 3 Place the weighing pan and the protective cover (3) on top of the weighing pan support (2).

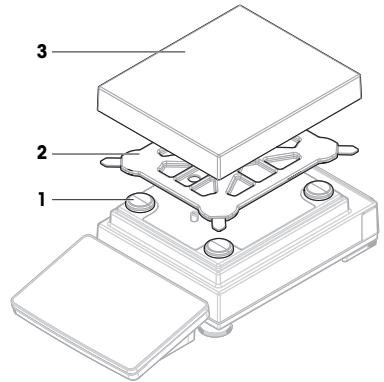


4.4.1.9 Assembling comparators 0.1 mg and 1 mg with LevelMatic weighing pan

i Note

The 0.1 mg balances with Pro draft shield are equipped with a seal. The aim of the seal is to isolate the weighing chamber from draft. The seal must always be correctly installed at the bottom of the Pro draft shield, as described in [Assembling the Pro draft shield for 0.1 mg balances and comparators ▶ Page 12].

- The seal is installed on the Pro draft shield.
- The Pro draft shield is installed on the weighing platform.

- 1 Place the bottom plate (1) into the Pro draft shield.
- 2 Place the LevelMatic holder (2) on top of the bottom plate (1).
- 3 Place the LevelMatic weighing pan (3) on top of the LevelMatic weighing pan holder (2).

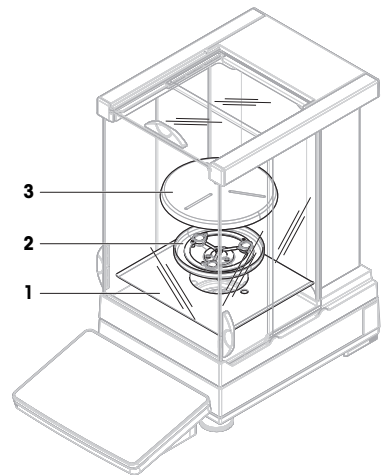

4.4.2 Balances and comparators with L weighing platform



4.4.2.1 Attaching the terminal to the weighing platform

The terminal can be attached to the long side or to the short side of the L weighing platform.

Note

On L weighing platforms, the terminal holder can be used with both balances and comparators.

- 1 Turn the weighing platform upside down.
- 2 Dismantle the screws (1) on the long side or the screws (2) on the short side of the weighing platform.
- 3 Connect the terminal to the weighing platform with the terminal connection cable.
- 4 Attach the terminal holder to the long side or to the short side of the weighing platform. Fix the terminal holder with the screws from the weighing platform.
- 5 Insert the terminal connection cable (3) into the cable channel.

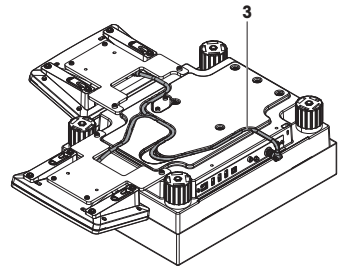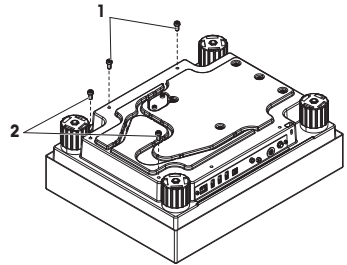


Note

When inserting the terminal connection cable into the cable channel, the terminal connection cable must be inserted simultaneously from both directions. The terminal connection cable must not have any play between the plug and the cable channel (see picture).

- 6 Turn the weighing platform.


4.4.2.2 Assembling balances 100 mg and 1 g

- 1 Place the weighing pan support caps (1) on top of the weighing platform.
- 2 Place the weighing pan (2) on top of the weighing pan support caps (1).

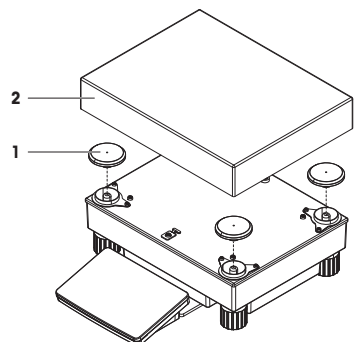

4.4.2.3 Assembling balances 10 mg with SmartPan weighing pan


- 1 Place the adapter plate (1) on top of the weighing platform.
- 2 Place the weighing pan support caps (2) on top of the adapter plate.
- 3 Place the draft shield element (3) on top of the adapter plate (1).
- 4 Place the SmartPan weighing pan (4) on top of the weighing pan support caps (2).
- 5 Place the weighing pan (5) on top of the SmartPan weighing pan (4) if needed.

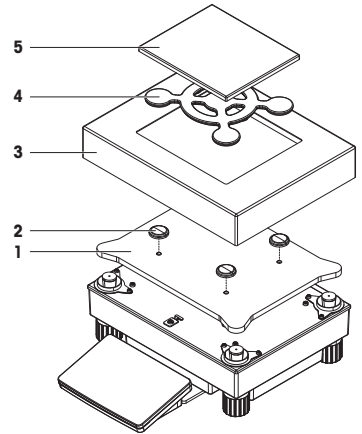

4.4.2.4 Removing and installing the transport safety screws (only for comparators)


Transport safety screws are used to prevent damaging the load cell during transport. Before installing the weighing pan, the transport safety screws on top of the weighing platform must be removed. Keep the transport safety screws for transporting the comparator.

- 1 Unscrew and remove the transport safety screws (1) from the top of the weighing platform.
- 2 Close the openings with the enclosed plastic covers.
- 3 Before transporting the comparator, reinstall the transport safety screws.

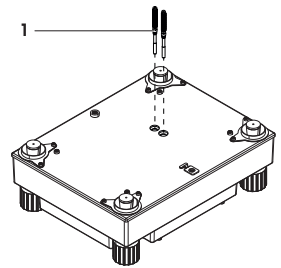

4.4.2.5 Assembling comparators 1 mg / 5 mg with LevelMatic weighing pan

- 1 Place the adapter plate with the LevelMatic base plate (1) on top of the weighing platform.
- 2 Place the draft shield element (2) on top of the adapter plate (1).
- 3 Place the LevelMatic weighing pan holder (3) on top of the LevelMatic base plate (1).
- 4 Place the LevelMatic weighing pan (4) on top of the LevelMatic weighing pan holder (3).

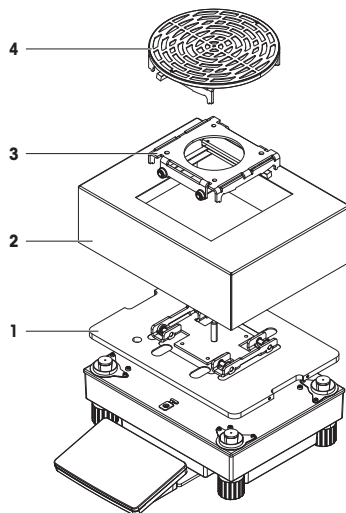

4.4.2.6 Assembling the comparator XPR64002LC-T



For instructions on how to assemble the comparator model XPR64002LC-T, refer to the Installation Instructions delivered with the comparator.

4.5 Putting into operation

4.5.1 Connecting the balance




WARNING

Death or serious injury due to electric shock

Contact with parts that carry a live current can lead to death or injury.

- 1 Only use the METTLER TOLEDO power cable and AC/DC adapter designed for your instrument.
- 2 Connect the power cable to a grounded power outlet.
- 3 Keep all electrical cables and connections away from liquids and moisture.
- 4 Check the cables and the power plug for damage and replace them if damaged.

- 1 Install the cables in such a way that they cannot be damaged or interfere with operation.
 - 2 Insert the plug of the AC/DC adapter (2) into the power inlet of the instrument (1).
 - 3 Secure the plug by firmly tightening the knurled nut.
 - 4 Insert the plug of the power cable into a grounded power outlet that is easily accessible.
- ➔ The balance automatically switches on.

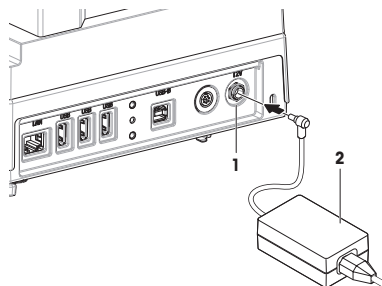

Note

Do not connect the instrument to a power outlet controlled by a switch. After switching on the instrument, it must warm up before giving accurate results.

See also


 General data ▶ Page 24

4.5.2 Switching on the balance

When connected to the power supply, the balance automatically switches on.

EULA (End User License Agreement)

When the balance is switched on the first time, the EULA (End User License Agreement) appears on the screen.

- 1 Read the conditions.
- 2 Tap **I accept the terms in the license agreement.** and confirm with  **OK.**
 - ➔ The main weighing screen appears.

Acclimatization and warm up

Before the balance gives reliable results, it must:

- acclimatize to the room temperature
- warm up by being connected to the power supply


The acclimatization time and warm-up time for balances and comparators are available in "General data".

Note

When the balance is exiting standby, it is ready immediately.

See also


 General data ▶ Page 24

 Entering / Exiting standby mode ▶ Page 20

4.5.3 Leveling the balance

Exact horizontal and stable positioning are essential for repeatable and accurate weighing results.

If the message **Balance is out of level** appears:

- 1 Tap  **Level the balance.**
 - ➔ The **Leveling aid** opens.
- 2 Follow the instructions from the wizard.






The leveling aid can also be accessed through the **Balance menu**:

Navigation: ▶ **Balance menu** >  **Leveling aid**



4.5.4 Performing an internal adjustment

Navigation: ▼ **Methods** >  **Adjustments**


- The adjustment **Strategy** is set to **Internal adjustment.**

- 1 Open the **Methods** section, tap  **Adjustments**, select the adjustment, and tap  **Start**
- or -
from the main weighing screen, tap  **More** and tap **Start adjustment.**
 - ➔ **Internal adjustment** is being executed.
 - ➔ When the adjustment has been completed, an overview of the adjustment results appears.
- 2 Tap  **Print** if you want to print the results.
- 3 Tap  **Finish adjustment.**
 - ➔ The balance is ready.

4.5.5 Entering / Exiting standby mode

- 1 To enter standby mode, hold 
 - ➔ The display is dark. The balance is still switched on.
- 2 To exit standby mode, press 
 - ➔ The display is turned on.

4.5.6 Switching off the balance

To completely switch off the balance, it must be disconnected from the power supply. By holding , the balance goes only into standby mode.

Note


When the balance was completely switched off for some time, it must warm up before it can be used.

See also

 Switching on the balance ▶ Page 19




4.6 Performing a simple weighing

4.6.1 Zeroing the balance


- 1 Open the draft shield, if applicable.
- 2 Clear the weighing pan.
- 3 Close the draft shield, if applicable.
- 4 Press  to zero the balance.
 - ➔ The balance is zeroed.

4.6.2 Taring the balance



If a sample vessel is used, the balance must be tared.

- 1 Open the draft shield, if applicable.
- 2 Clear the weighing pan.
- 3 Close the draft shield, if applicable.
- 4 Press  to zero the balance.
- 5 Open the draft shield, if applicable.
- 6 Place the sample vessel on the weighing pan.
- 7 Close the draft shield, if applicable.
- 8 Press  to tare the balance.
 - ➔ The balance is tared. The icon  appears.

4.6.3 Performing a weighing

- 1 Open the draft shield, if applicable.
- 2 Place the weighing object into the sample vessel.
- 3 Tap  **Add result** if you want to report the weighing result.
 - ➔ The result is added to the **Results list**.

4.6.4 Completing the weighing

- 1 To save the **Results list**, tap  **Complete**.
 - ➔ The window **Complete task** opens.
- 2 Select an option to save or print the **Results list**.
 - ➔ The respective dialog opens.
- 3 Follow the instructions from the wizard.
- 4 Tap  **Complete**.
 - ➔ The **Results list** is saved/printed and then cleared.

4.7 Transporting, packing and storing



NOTICE


Damage to the draft shield, terminal or additional terminal stand

Do not hold the balance only by the glass draft shield, by the terminal or by the terminal stand when carrying the balance.

- Remove the terminal of the S weighing platform from the terminal holder and place the terminal on top of the weighing pan. Always hold the weighing platform with both hands when carrying the balance.

4.7.1 Transporting the balance over short distances

- 1 Disconnect the balance from the AC/DC adapter.
- 2 Unplug all interface cables if necessary.
- 3 Remove the terminal from the terminal holder and place the terminal on top of the weighing platform (only for S weighing platform).
- 4 Hold the weighing platform with both hands and carry the balance in horizontal position to the target location. Consider the requirements of the location.

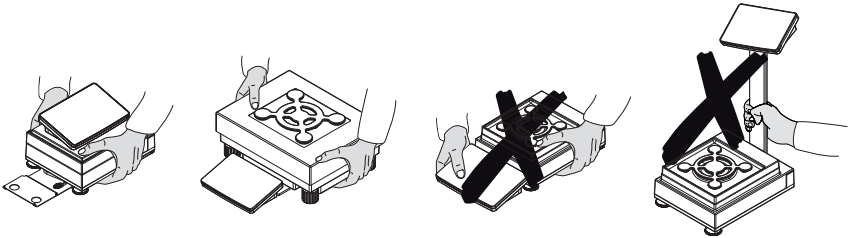

See also

- 🔗 Selecting the location ▶ Page 7
- 🔗 Leveling the balance ▶ Page 19
- 🔗 Performing an internal adjustment ▶ Page 19

4.7.2 Transporting the balance over long distances

METTLER TOLEDO recommends using the original packaging for transportation or shipment of the balance or balance components over long distances. The elements of the original packaging are developed specifically for the balance and its components and ensure maximum protection during transportation.



NOTICE

Damage to the comparator

Always install the transport safety screws on top of the weighing platform when transporting the comparator over long distances.

See also

- 🔗 Removing and installing the transport safety screws (only for comparators) ▶ Page 17

4.7.3 Packing and storing

Packing the balance

Store all parts of packaging in a safe place. The elements of the original packaging are developed specifically for the balance and its components, and ensures maximum protection during transportation and storage.

Storing the balance

Only store the balance under the following conditions:

- Indoor and in the original packaging
- According to the environmental conditions, see "Technical Data"

Note

When storing for longer than 6 months, the rechargeable battery may become empty (only date and time get lost).

See also

 [Technical Data](#) ▶ Page 24

5 Maintenance

To guarantee the functionality of the balance and the accuracy of the weighing results, a number of maintenance actions must be performed by the user.



For further information, consult the Reference Manual (RM).

 www.mt.com/XPR-precision-RM

5.1 Maintenance tasks

Maintenance action	Recommended interval	Remarks
Performing an internal adjustment	<ul style="list-style-type: none">• Daily• After cleaning• After leveling• After changing the location	see "Performing an internal adjustment"
Performing routine tests (eccentricity test, repeatability test, sensitivity test). METTLER TOLEDO recommends to at least perform a sensitivity test.	<ul style="list-style-type: none">• After cleaning• After assembling the balance• After a software update• Depending on your internal regulations (SOP)	see "Tests" in the Reference Manual
Cleaning	<ul style="list-style-type: none">• After every use• After changing the substance• Depending on the degree of pollution• Depending on your internal regulations (SOP)	see "Cleaning"
Updating the software	<ul style="list-style-type: none">• Depending on your internal regulations (SOP).• After a new software release.	see "Software update" in the Reference Manual

See also

 [Performing an internal adjustment](#) ▶ Page 19

 [Cleaning](#) ▶ Page 23

5.2 Cleaning


5.2.1 Disassembling the Pro draft shield for cleaning




CAUTION

Injury due to sharp objects or broken glass

- Instrument components, e.g., glass, can break and lead to injuries.
- Always proceed with focus and care.

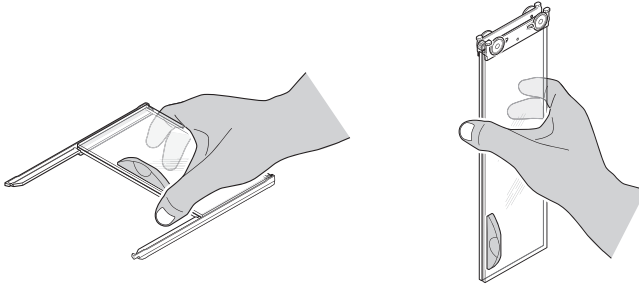

- 1 Remove the weighing pan and/or SmartPan weighing pan.
 - 2 Lift the Pro draft shield off the weighing platform and place it on a clean surface.
 - 3 Remove the drip tray.
 - 4 Turn the cover (1) to the front.
 - 5 Pull the top glass back and out of the housing.
 - 6 Pull the side glasses back out of the housing.
- ➔ The Pro draft shield is ready for cleaning.

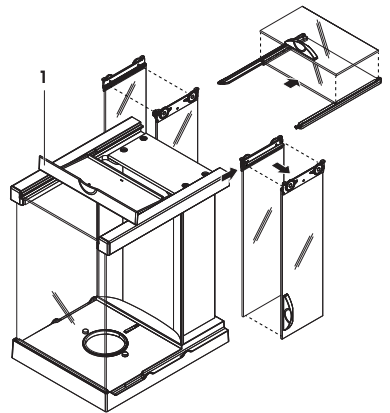

5.2.2 Cleaning the balance



NOTICE

Damage to the instrument due to inappropriate cleaning methods

If liquid enters the housing, it can damage the instrument. The surface of the instrument can be damaged by certain cleaning agents, solvents, or abrasives.

- 1 Do not spray or pour liquid on the instrument.
- 2 Only use the cleaning agents specified in the Reference Manual (RM) of the instrument or the guide "8 Steps to a Clean Balance".
- 3 Only use a lightly moistened, lint-free cloth or a tissue to clean the instrument.
- 4 Wipe off any spills immediately.



For further information on cleaning a balance, consult "8 Steps to a Clean Balance".

► www.mt.com/lab-cleaning-guide

Cleaning around the balance

- Remove any dirt or dust around the balance and avoid further contaminations.

Cleaning the terminal

- Clean the terminal with a damp cloth or a tissue and a mild cleaning agent.

Cleaning the removable parts

- Clean the removed part with a damp cloth or a tissue and a mild cleaning agent or clean in a dishwasher up to 80 °C.

Cleaning the weighing unit

- 1 Disconnect the balance from the AC/DC adapter.
- 2 Use a lint-free cloth moistened with a mild cleaning agent to clean the surface of the balance.
- 3 Remove powder or dust with a disposable tissue first.
- 4 Remove sticky substances with a damp lint-free cloth and a mild solvent, e.g., isopropanol or ethanol 70%.

5.2.3 Putting into operation after cleaning

- 1 Reassemble the balance.
- 2 Check that the draft shield doors (top, sides) open and close normally.
- 3 Check if the terminal is connected to the balance.
- 4 Reconnect the balance to the AC/DC adapter.
- 5 Check the level status, level the balance if necessary.
- 6 Respect the warm-up time specified in the "Technical Data".
- 7 Perform an internal adjustment.
- 8 Perform a routine test according to the internal regulations of your company. METTLER TOLEDO recommends performing a sensitivity test after cleaning the balance.
- 9 Press →0← to zero the balance.
 - ⇒ The balance is ready to be used.

See also

- 🔗 Leveling the balance ► Page 19
- 🔗 Technical Data ► Page 24
- 🔗 Performing an internal adjustment ► Page 19

6 Technical Data

6.1 General data

Power supply

AC/DC adapter (model no. FSPO60-DHAN3):

Input: 100 – 240 V AC ± 10%, 50 – 60 Hz, 1.8 A
Output: 12 V DC, 5 A, LPS, SELV

AC/DC adapter (model no. FSPO60-DIBAN2):

Input: 100 – 240 V AC ± 10%, 50 – 60 Hz, 1.5 A
Output: 12 V DC, 5 A, LPS, SELV

Cable for AC/DC adapter:

3-core, with country-specific plug

Balance power consumption:

12 V DC ± 10%, 2.25 A

Polarity:



Protection and standards

Overvoltage category:	II
Degree of pollution:	2
Standards for safety and EMC:	See Declaration of Conformity
Range of application:	Use only indoors in dry locations

Environmental conditions

The limit values apply when the balance is used under the following environmental conditions:

Height above mean sea level:	Up to 5000 m
Ambient temperature:	+10 – +30 °C
Temperature change, max.:	5 °C/h
Relative air humidity:	30 – 70%, non-condensing
Acclimatization time:	At least 4 hours after placing the instrument in the same location where it will be put into operation.
Warm-up time:	At least 30 minutes after connecting the balance to the power supply. When switched on from standby, the instrument is ready for operation immediately.

The balance can be used under the following environmental conditions. However, the weighing performances of the balance may be outside the limit values:

Ambient temperature:	+5 °C – +40 °C
Relative air humidity:	20% to max. 80% at 31 °C, decreasing linearly to 50% at 40 °C, non-condensing

The balance can be disconnected and stored in its packaging under the following conditions:

Ambient temperature:	-25 – +70 °C
Relative air humidity:	10 – 90%, non-condensing

Environmental conditions for comparators

Comparators need to be used under the following environmental conditions to reach the specified performances:

Acclimatization time:	At least 8 hours after placing the instrument in the same location where it will be put into operation.
Warm-up time:	At least 60 minutes after connecting the balance to the power supply. When switched on from standby, the instrument is ready for operation immediately.
Air speed, max.:	0.15 m/s

7 Disposal

In conformance with the European Directive 2012/19/EU on Waste Electrical and Electronic Equipment (WEEE) this device may not be disposed of in domestic waste. This also applies to countries outside the EU, per their specific requirements.

Please dispose of this product in accordance with local regulations at the collecting point specified for electrical and electronic equipment. If you have any questions, please contact the responsible authority or the distributor from which you purchased this device. Should this device be passed on to other parties, the content of this regulation must also be related.



GWP®

Good Weighing Practice™

GWP® is the global weighing standard, ensuring consistent accuracy of weighing processes, applicable to all equipment from any manufacturer. It helps to:

- Choose the appropriate balance or scale
- Calibrate and operate your weighing equipment with security
- Comply with quality and compliance standards in laboratory and manufacturing

 www.mt.com/GWP

www.mt.com/XPR-precision

For more information

Mettler-Toledo GmbH

Im Langacher 44
8606 Greifensee, Switzerland
www.mt.com/contact

Subject to technical changes.
© 08/2022 METTLER TOLEDO. All rights reserved.
30357071E en



30357071